


ENGINE 112, 113 in MODEL 163.1## ## up to 357786
 ENGINE 112 in MODEL 202.02
 ENGINE 112 in MODEL 202.08
 ENGINE 112 in MODEL 210.06
 ENGINE 113 in MODEL 210.07
 ENGINE 112 in MODEL 210.663
 ENGINE 112 in MODEL 210.26# ## up to 276396
 ENGINE 113 in MODEL 210.27# ## up to 276396
 ENGINE 112, 113 in MODEL 210.08# ## up to 084039
 ENGINE 112, 113 in MODEL 210.28# ## up to 084039

Operation no. of operation texts or standard texts and flat rates

Category	Op. no.	Operation text	Time	Acc. no.	Code
P	023813	Remove/install/replace gasket between intake pipe and throttle valve	006 WU/0.5 h	---	---

Damage code	Cause	Remedy	
14 034 04	Gasket (B) between intake pipe (A) and throttle valve defective. <i>i</i> High oil consumption of more than 0.8 liters per 1000 km.	<i>i</i> In order to avoid erroneous removal the following documents must be processed before starting the work: # High oil consumption Measure oil consumption	AF18.00-P-8044D AR18.00-P-0025AV
		1 Remove,/install/replace gasket (B) between intake pipe (A) and throttle valve.	AR07.07-P-1454A
		<i>i</i> Use new gasket according to parts ordering notes Old gasket with part number 112 141 01 80 should no longer be used.	

A Intake pipe
 B Gasket

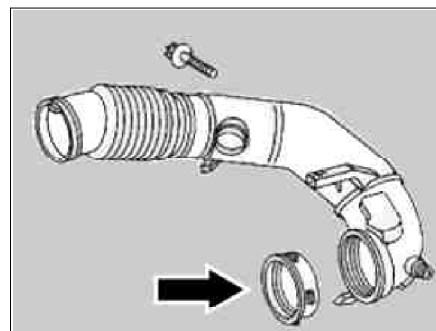

P07.07-2038-01

Parts ordering notes

Part no.	Designation	Quantity
A 112 141 18 80	Gasket	1