

AF01.40-P-4000AU	Oil leak out of drain opening on left side of engine (cylinder 6)	21.1.98
------------------	---	---------

ENGINE 112 in MODEL 129, 163, 170, 202, 203, 208, 210, 220

ENGINE 113 in MODEL 129, 163, 202, 208, 210, 215, 220

ENGINE 112 in MODEL 463

ENGINE 113 in MODEL 463

Modification notes

23.3.99	Supersedes STIP no. 01.40-004 dated 15.1.98	Validity and cause modified	
---------	---	-----------------------------	--

Damage code	Cause	Remedy	
	Threaded connection of oil duct in front of crankcase V is installed without or with a damaged sealing ring. Consequently, engine oil in V of crankcase below intake module. Engine oil flows out of drain opening on left side of engine behind cylinder 6 and 8 resp.	1 Remove intake module 2 Replace sealing ring	

Parts ordering notes

Part no.	Designation	Quantity
023 997 70 48	Sealing ring	1