

MODEL 163.154 /172 #A as of 145273,
163.136 /154 /172 #X as of 708319,
163.113 /128 /175 with CODE (847) 3rd seat row

Operation no. of operation texts or standard texts and flat rates

Sector	Op. no.	Operation text	Time	Acc. no.	Code
P	023612	SECURE BOWDEN CABLE FOR EASY-ENTRY RELEASE HANDLE	005 AW/0,4 h	92 139 38	---

Damage Code	Cause	Remedy	
	Release cable disconnected from eyelets at top of telescoping strut.	1 Slide one piece of shrink-on tubing (1), approximately 25 mm long, onto release cable.	
		2 Reattach right end of release cable to eyelet at top of telescoping strut (2).	
		3 Position shrink-on tubing (1) over right cable connection to eyelet.	
		4 Reattach left end of release cable to eyelet at top of telescoping strut (2).	
		5 Position a second piece of shrink-on tubing (3), approximately 25 mm long, over left cable connection eyelet.	
		6 Carefully heat tubing until they shrink securely over release cable ends and eyelets of telescoping strut. ⓘ Do not damage seat cover. 🔥 Hot air gun	*WE58.40-Z-1007-03A
		7 Verify proper function of easy-entry seat.	

- 1 Shrink-on tubing
- 2 Telescoping strut
- 3 Shrink-on tubing



P91.12-2444-06

Workshop equipment/MB testers (refer to Workshop equipment manual)

WE58.40-Z-1007-03A	Hot air gun
--------------------	-------------