| AF26.1 | 0-P-1300AV | Vibrations at gear shift lever and/or rattling noises from transmission | 21.1.99 |  |
|--------|------------|---|---------|--|
|--------|------------|---|---------|--|

TRANSMISSION 717.41# ## as of 6977520 as of 9.2.96 in MODEL 124, 170, 201, 202, 208, 210 TRANSMISSION 717.46# ## as of 6989499 as of 26.2.96 in MODEL 129, 163, 170, 202, 208, 210

| Damage code | Cause  | Remedy                                     |
|-------------|--|--|
|             | Shift blocks of gear shift arm vibrate in slot of sliding sleeve | 1 Remove old gear shift arm/sliding blocks |
|             | i Vibrations and/or rattling noises occur in 1st/2nd gear        | 2 Install new gear shift arm/shift fork    |

## Parts ordering notes

| Part no.          | Designation                                       | Quantity |
|-------------------|---|----------|
| 202 260 00 30 /81 | Gear shift arm with bearing (transmission 717.41) | 1        |
| 210 260 00 30 /81 | Gear shift arm with bearing (transmission 717.46) | 1        |
| 124 265 00 01     | 1st/2nd gear shift fork                           | 1        |