

AF82.70-P-2005A	Display "Processing" or "Connecting call" appears permanently in instrument cluster	8.10.03
-----------------	---	---------

MODEL 163, 203, 209, 230

with CODE (386) Preinstallation for "Cell phone" UHI telephone system

with CODE (388) "Cell phone" UHI telephone system

MODEL 463

with CODE (EH1) Nokia cell phone with hands-free system, GSM and UHI

with CODE (EV8) Hands-free system for cell phone with UHI

Modification notes

9.3.04	Content updated	Remedy has been updated and work units and parts ordering notes have been added
--------	-----------------	---

Operation no. of operation texts or standard texts and flat rates

Category	Op. no.	Operation text	Time	Acc. no.	Code
P	829292	Remove/install bracket for cell phone (UHI) on the instrument panel, replace if necessary (after testing), model 163	001 WU	---	---
P	829293	Remove/install cell phone (UHI) in the armrest, replace if necessary (after testing), model 203, 209, 230, 463	001 WU	---	---

Damage code	Cause	Remedy
82 795 73	Software problems in the UHI control unit (Universal Cell Phone Interface).	1 Remove/install/replace cell phone bracket
	<p>After inserting the cell phone in the bracket and starting the engine, "Processing" is shown in the instrument cluster.</p> <p>Furthermore, after entering a telephone number and the call is being connected, "Connecting call" is displayed in the instrument cluster. In addition to this, no connection can be made, although there is good reception.</p> <p>i Both of these messages disappear after the cell phone has been taken out and reinserted into the bracket a couple of times.</p>	<p>i Operation numbers and WUs will be available with ASRA update 05/04. Until then please enter the operation number and the WU manually.</p>

Parts ordering notes

Part no.	Designation	Quantity
A 230 820 05 51	Cell phone bracket (cradle) version Q7	1
B6 787 58 22	Cell phone bracket (cradle) version Q5 or higher	1