

MODEL 163, 203, 209, 230

with CODE (386) Preinstallation for "Cell phone" UHI telephone system

with CODE (388) "Cell phone" UHI telephone system

MODEL 463

with CODE (EH1) Nokia cell phone with hands-free system, GSM and UHI

with CODE (EV8) Hands-free system for cell phone with UHI

Modification notes

| | | | |
|---------|--|--|--|
| 22.6.04 | Work no. 829292 added, work step and parts ordering notes supplemented | | |
|---------|--|--|--|

Operation no. of operation texts or standard texts and flat rates

| Category | Op. no. | Operation text | Time | Acc. no. | Code |
|----------|---------|---|--------|----------|------|
| P | 547989 | Disconnect/reconnect ground cable at on-board electrical system battery (when disconnecting electrical connectors with KL.30) | 005 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 163 | 003 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 203.0 | 007 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 203.2 | 009 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 209.3 | 005 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 209.4 | 012 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 230 | 026 WU | --- | --- |
| P | 827462 | Remove and install telephone interface, replace according to condition, model 463 | 017 WU | --- | --- |
| P | 829292 | Remove/install bracket for cell phone (UHI) on the instrument panel, replace if necessary (after testing), MODEL 163 | 001 WU | --- | --- |
| P | 829293 | Remove/install cell phone (UHI) in the armrest, replace if necessary (after testing), MODEL 203, 209, 230, 463 | 001 WU | --- | --- |
| P | 541011 | Perform quick test | 004 WU | --- | --- |

| Damage code | Cause | Remedy | |
|-------------|---|---|--|
| 82 797 90 | Reaction of the UHI control unit (Universal Cell Phone Interface) to voltage dips when engine is started. i After cell phone has been inserted into bracket and engine is started the cell phone is turned off. | 1 Remove/install/replace UPCI telephone control unit. i Use telephone control unit according to Parts ordering notes. | |
| | From time to time the PIN inquiry then appears again. | i The error can reoccur rarely after replacing the UHI telephone control module In this case: # | |
| | | 2 Remove, install UHI portable cellular telephone mount, replace i Use CTEL bracket according to parts ordering note | |

Parts ordering notes

| Part no. | Designation | Quantity |
|-----------------|--|----------|
| A 230 820 42 26 | UPCI telephone control unit (software release 38/03, Q4) | 1 |
| A 171 820 04 51 | UHI portable cellular telephone mount (B 678 758 22, Q9) | 1 |