AF88.70-P-1100AG	Wind noise at outside mirror on left and/or right front door	30.10.03	Ì
------------------	--	----------	---


MODEL 163.154 #A as of 289560, 163.113 /128 #X as of 754620, 163.113 /174 #A as of 289560 up to 486952, 163.128 /157 /175 #A up to 486952

Operation no. of the operation texts or standard texts and flat rates


Range	Op. no.	Operation text	Flat rate	Acc. no.	Code
Р	024204	Foam on base of outside rearview mirror, Location: install	004 WU	81 101 39	

Damage Code	Cause	Remedy	
81 101 39	Insufficient seal pressure between door and	1 Remove outside rearview mirror (1) only on side where wind noise occurs.	AR88.70-P-9000GH
	base of mirror mount.	on side where wind noise occurs.	*110589035900
		2 Install foam (2) onto base of mirror mount around wiring harness.	
		3 Reinstall outside rearview mirror (1).	AR88.70-P-9000GH
		i Replace foam on inside of door around hole where mirror wiring harness comes through.	

- Outside rearview mirror
- 2 Foam

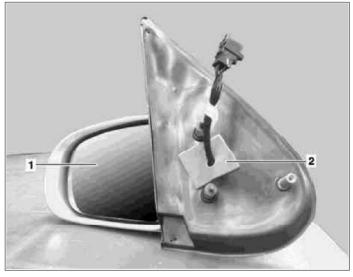

P88.70-2311-11

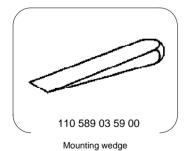

Parts ordering notes

Part no.	Designation	Quantity
163 682 25 28	Foam	2