
SI72.10-P-0002GH

Service Information: Modification of the front door

MODEL 163.113 /128 /136 /154 /157 /172 /174 /175

- Side airbag 1
- Attachment hole Locating hole 2
- 3
- 4 Locating pin

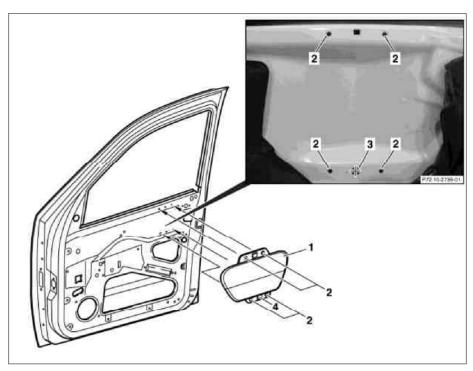

P72.10-2740-06

 \fbox{i} Due to a design modification to the door skin, both parts must be checked when exchanging the door or the sidebag.

1	Check the replacement door to see if the aligning bore for the sidebag is present	i Should the replacement door not have an aligning bore and the sidebag is equipped with a fixing pin:	
		Modify the front door	SM72.10-P-0004A
2	Check to see of the fixing pin is present for the replacement sidebag	i If there is no fixing pin present on the sidebag, the door does not need to be modified.	