





MODELS 163.113/136/154/172/174 up to 31.8.01 with CODE (580) air conditioning or Tempmatic for USA

- 1 Center part of instrument panel  
 2 Defroster cable  
 3 Footwell ventilation cable  
 4 Pushbutton control module  
 X72/3 Connector

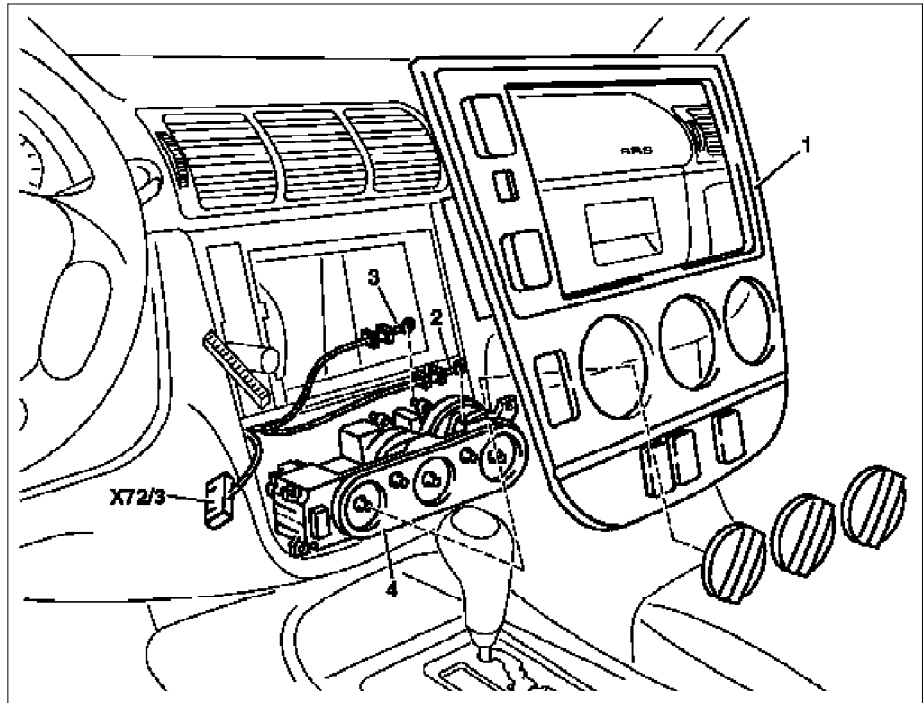

P83.20-0262-06

 	Remove/install		
1	Remove radio		AR82.60-P-7502EA
2	Remove center part of instrument panel (1)		AR68.10-P-1030GH
3	Unscrew bolts at heater/AC controls (4) and remove controls		
4	Detach cable (2, 3)	 Unclip cables at heater/AC controls.	
5	Disconnect connector (X72/3) at heater/AC controls (4)		
6	Install in the reverse order		